




Stefan David Thiemann

Dissertation to obtain Degree
Dr. rer. nat.

Detection and Assessment of Erosion and Soil Erosion Risk in the Watershed of the Bilate River

—

Southern Ethiopian Rift Valley

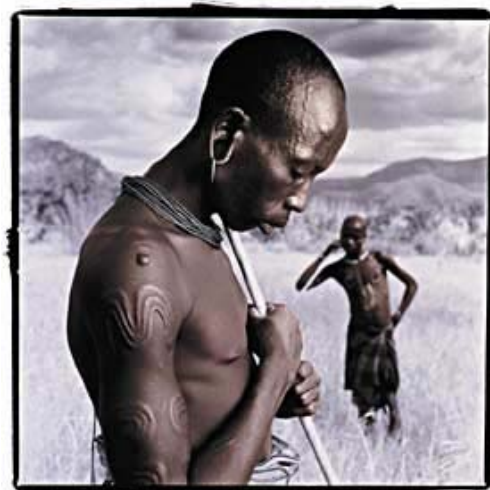

07.07.2006

Chairperson of the Examination Board:

Univ. Prof. Dr. phil. Brigitta Schütt

Freie Universität Berlin

Supervisors:

Univ. Prof. Dr. phil. Brigitta Schütt

Freie Universität Berlin

Univ. Prof. Dr.-Ing. Gerd Förch

University of Siegen

Acknowledgements

I would like to thank my dissertation advisors Prof. Dr. Brigitta Schütt and Prof. Dr. Gerd Förch for their great support, advise, patience, and technical assistance as well as for long and fruitful discussions on this research. Their roles as mentors have been invaluable and irreplaceable. I would like to thank Prof. Dr. Brigitta Schütt for her provision of the laboratories and an office at the Freie Universität Berlin and for her excellent input during several field trips in Ethiopia. Special thanks to Prof. Dr. Gerd Förch for his steady encouragement and his input from the engineering field, as well as for the provision of a workplace at the Universität Siegen during the entire doctoral research. His network in Ethiopia was extremely valuable in facilitating this research in the field.

Dr. Kai Hartmann, Dr. Steffen Möller and Dr. Hans-Peter Röper, all from the Freie University Berlin advised me in topics of remote sensing, statistics and laboratory analysis. I would like to thank all three of them for their multiple and fruitful input.

This research was made possible through the support of the German Technical Cooperation GTZ. They assisted my field trips during all stays in Ethiopia and funded my working period at the University of Siegen. The German Academic Exchange Service DAAD, through a Ph.D. scholarship, funded several months of field research in Ethiopia. The German Research Foundation DFG provided funding for a project in Ethiopia of which my research was a part. Last, the University of Siegen provided funds for laboratory analysis and purchase of technical equipment. Thanks to all of these groups for their support.

I would like to also thank Dr. Eckart Bode, who always had an open ear for me in Ethiopia. Thanks also to Dr. Seleshi Bekele and his team from the Arba Minch University, who always gave good assistance during my stays at Arba Minch.

And special thanks to Michael and Wiebke for their invaluable discussions and input, particularly in the final stages of this dissertation.

Content:

ABSTRACT	1
1 INTRODUCTION	3
2 DEFINITIONS AND EXPLANATIONS	5
2.1 EROSION AND SOIL EROSION	5
2.2 RISK ASSESSMENT	6
2.3 EXPLANATIONS OF TERMS	6
3 LITERATURE REVIEW	7
3.1 EROSION- AND SOIL EROSION MODELS	7
3.2 CAUSES OF EROSION AND SOIL EROSION IN THE TROPICS	11
4 COUNTRY PROFILE	17
4.1 GEOGRAPHICAL SETTINGS.....	18
4.1.1 <i>Major Landscapes</i>	18
4.1.2 <i>Drainage System</i>	18
4.1.3 <i>Soils</i>	19
4.1.4 <i>Climate</i>	20
4.2 GEOLOGY AND PALEOGEOGRAPHY.....	23
4.3 HUMAN DYNAMICS	26
4.3.1 <i>Demography</i>	26
4.3.2 <i>Land Use</i>	27
4.3.3 <i>Economy</i>	29
PART I: ASSESSMENT OF MODEL-INPUT-DATA	31
5 METHODOLOGY	31
5.1 RELIEF ANALYSIS	31
5.2 RAINFALL – RUNOFF ANALYSIS	32
5.3 ASSESSMENT OF EROSION AND SOIL EROSION DAMAGES	34
5.3.1 <i>Field Work</i>	34
5.3.2 <i>Remote Sensing</i>	35
5.4 ANALYSIS OF SOILS AND SOIL SEDIMENTS	36
5.4.1 <i>Secondary data</i>	36
5.4.2 <i>Primary Data</i>	36
5.5 DETERMINATION OF VEGETATION COVER AND LAND COVER	39
6 DESCRIPTION OF THE STUDY AREA	41
6.1 BILATE WATERSHED	41
6.1.1 <i>Geology</i>	41
6.1.2 <i>Morphometry</i>	43
6.1.3 <i>Soil</i>	46
6.1.4 <i>Climate</i>	48
6.1.5 <i>Land Use</i>	49

6.2	GEOMORPHOLOGICAL UNITS	52
6.2.1	<i>Western Ethiopian Highlands (WEH)</i>	53
6.2.2	<i>Valleys and Basin (VB)</i>	53
6.2.3	<i>Rift Valley (RV)</i>	54
6.3	STUDY SITES.....	58
6.3.1	<i>Ana</i>	60
6.3.2	<i>Doyancho</i>	62
6.3.3	<i>Hage</i>	63
6.3.4	<i>Ofi</i>	65
6.3.5	<i>Bedesa</i>	67
6.3.6	<i>Dimtu</i>	69
6.3.7	<i>Sedebo</i>	70
6.3.8	<i>Agega</i>	72
7	RESULTS.....	77
7.1	RAINFALL - RUNOFF ANALYSIS	77
7.1.1	<i>Rainfall</i>	77
7.1.1.1	<i>Rainfall Variability</i>	77
7.1.1.2	<i>Rainfall Totals</i>	81
7.1.1.3	<i>Rainfall Intensity</i>	82
7.1.2	<i>Runoff</i>	85
7.1.3	<i>Rainfall-Runoff</i>	88
7.2	EROSION AND SOIL EROSION DAMAGES	90
7.2.1	<i>Sheet erosion</i>	91
7.2.2	<i>Rill Erosion</i>	91
7.2.3	<i>Gully Erosion</i>	93
7.2.4	<i>Badland Erosion</i>	95
7.2.5	<i>Barren Land Degradation</i>	96
7.3	SOILS AND SOIL SEDIMENTS	98
7.4	LAND COVER	106
8	DISCUSSION.....	113
8.1	RAINFALL-RUNOFF.....	113
8.1.1	<i>Rainfall</i>	113
8.1.2	<i>Runoff</i>	116
8.1.3	<i>Rainfall-Runoff</i>	117
8.2	EROSION- AND SOIL EROSION.....	118
8.2.1	<i>Sheet Erosion</i>	118
8.2.2	<i>Rill Erosion</i>	119
8.2.3	<i>Gully Erosion</i>	123
8.2.4	<i>Badland Erosion</i>	124
8.2.5	<i>Barren Land Degradation</i>	125

8.3	SOILS AND SOIL SEDIMENTS	126
8.4	LAND COVER	129
PART II: MODELLING EROSION AND SOIL EROSION RISK.....		131
9	MODEL DESER.....	131
9.1	MODELLING APPROACH	132
9.1.1	<i>Input Factors</i>	132
9.1.2	<i>Algorithms</i>	137
9.2	RESULTS	141
9.3	DISCUSSION	147
9.3.1	<i>Uncertainty and Sensitivity Analysis</i>	147
9.3.2	<i>Validation</i>	153
9.4	SCENARIOS	155
9.5	LIMITATIONS	157
10	CONCLUSION	159
11	SUMMARY.....	161
12	ZUSAMMENFASSUNG.....	167
13	REFERENCES	173
14	APPENDICES	187
14.1	INTERVIEWS.....	187
14.2	DESCRIPTION OF PROFILES	190
14.3	LABORATORY ANALYSIS	206
14.4	DAMAGE MAPS.....	224
14.5	CURRICULUM VITAE.....	230

Figures:

Fig. 1:	Ethiopia and the Horn of Africa.....	17
Fig. 2:	Relief and Major Landscapes of Ethiopia.....	18
Fig. 3:	Drainage Basins of Ethiopia.....	19
Fig. 4:	Soils in Ethiopia.....	20
Fig. 5:	Climatic Classification after Köppen & Geiger.....	21
Fig. 6:	Mean Annual Precipitation.....	22
Fig. 7:	Rainfall Regimes.....	23
Fig. 8:	Geology of Ethiopia.....	24
Fig. 9:	Midyear Population Estimates and Average Annual Period Growth Rates.....	26
Fig. 10:	Midyear Population 2005 and 2025.....	27
Fig. 11:	Population Distribution.....	28
Fig. 12:	Geology of the <i>Bilate</i> Watershed.....	42
Fig. 13:	Fracture Pattern and Volcanoes.....	43
Fig. 14:	<i>Bilate</i> Watershed: Relief and Drainage System.....	44
Fig. 15:	Longitudinal Profile of the <i>Bilate River</i>	44
Fig. 16:	Distribution of Altitude and Slope Classes.....	45
Fig. 17:	Distribution of Flow Accumulation and Complex Curvature of the Watershed.....	46
Fig. 18:	Soil Types of the <i>Bilate</i> Watershed.....	47
Fig. 19:	Pyroclastic Layers in the Rift Valley.....	48
Fig. 20:	Small Scale Subsistence Farming in the <i>Western Ethiopian Highlands</i>	50
Fig. 21:	Traditional Plough <i>Maresha</i>	50
Fig. 22:	Agro-climatic Regions of Ethiopia: Region of the <i>Bilate Watershed</i> = Region 5 ‘kolla’.....	51
Fig. 23:	Geomorphological Units of the Watershed.....	52
Fig. 24:	Distribution of Altitude Classes within the Geomorphological Units.....	53
Fig. 25:	Slope Classes within the Geomorphological Units.....	54
Fig. 26:	Complex Curvature of the relief within the Geomorphological Units.....	55
Fig. 27:	Flow Accumulation within the Geomorphological Units.....	55
Fig. 28:	Boxplots of Morphometry of Geomorphological Units.....	57
Fig. 29:	Study Sites within the <i>Bilate</i> watershed.....	59
Fig. 30:	Ana Study Site: Relief and Settlement.....	60
Fig. 31:	Captured Surface Runoff.....	61
Fig. 32:	<i>Doyancho</i> Study Site: Relief and Settlement.....	62

Fig. 33:	Landslide on Steep Slope	63
Fig. 34:	Badland Areas	63
Fig. 35:	<i>Hage</i> Study Site: Relief and Settlement	64
Fig. 36:	Contour Ploughing	65
Fig. 37:	Landslide on Steep Slope	65
Fig. 38:	<i>Ofi</i> Study Site: Relief and Settlement	66
Fig. 39:	Ash Layer at Study Site <i>Ofi</i>	66
Fig. 40:	Water Harvesting on Fields.....	67
Fig. 41:	<i>Bedesa</i> Study Site: Relief and Settlement	68
Fig. 42:	Gully on Grassland within the State Farm	68
Fig. 43:	Wind Erosion on Ploughed Fields.....	69
Fig. 44:	<i>Dimtu</i> Study Site: Relief and Settlement	70
Fig. 45:	Severe Erosion and Soil Erosion Damages	70
Fig. 46:	<i>Sedebo</i> Study Site: Relief and Settlement	71
Fig. 47:	Badlands and Total Soil Loss.....	72
Fig. 48:	Sedimentation in a Channel and on the Alluvium.....	72
Fig. 49:	<i>Agega</i> Study Site: Relief and Settlement	73
Fig. 50:	Closed Area on a Steep Slope	74
Fig. 51:	Colluvium and Alluvium.....	74
Fig. 52:	Meteorological Stations (red dots) in the Research Area.....	78
Fig. 53:	Computed Annual Precipitation	79
Fig. 54:	Mean Annual Precipitation Variability of Selected Meteorological Stations	80
Fig. 55:	El Niño Events plotted against Annual Precipitation.....	80
Fig. 56:	Rainfall Intensity Index in the Geomorphological Units	84
Fig. 57:	Rainfall Intensity Index in the <i>Bilate</i> Watershed	85
Fig. 58:	Monthly Discharge of the <i>Bilate</i> at <i>Alaba Kulito</i> gauging station	87
Fig. 59:	Average Discharge of the <i>Bilate</i> and Tributaries	88
Fig. 60:	Discharge Volumes versus Precipitation Volumes at <i>Batena</i> Gauging Station in 1992	89
Fig. 61:	Off-Site Damages due to Sheet Erosion.....	91
Fig. 62:	Rill Erosion in the Western Ethiopian Highlands	92
Fig. 63:	Rill Erosion on Long Slopes	92
Fig. 64:	Gullies on Steep Slopes and Agricultural Land	93
Fig. 65:	Gullies at Different Relief Positions	93
Fig. 66:	Gullies at Study Area <i>Dimtu</i>	94
Fig. 67:	Gully System in Transition Zone (<i>WEH/RV</i>).....	94

Fig. 68:	Badlands in the Geomorphological Unit <i>Valleys and Basin</i>	95
Fig. 69:	Vegetation Recovery on a Badland at <i>Sedebo</i> Study Site	96
Fig. 70:	Off-site Damages at <i>Sedebo</i> Study Site.....	96
Fig. 71:	Gully Concentration Developing a Barren Degraded Land	97
Fig. 72:	Aerial Photograph of the <i>Bilate</i> in the <i>Rift Valley</i>	97
Fig. 73:	Location of Samples from Topsoils and Profiles	98
Fig. 74:	CIE Colours of Profile Samples	101
Fig. 75:	Susceptibility of Profile Samples	101
Fig. 76:	PH-values of Profile Samples	102
Fig. 77:	Electric Conductivity of Profile Samples.....	102
Fig. 78:	Organic Carbon Content of Profile Samples.....	103
Fig. 79:	Grain Size (Sand Fraction) of Profile Samples	104
Fig. 80:	Clay and Silt Ratio of Profile Samples.....	104
Fig. 81:	Mineralogical composition of VP032 2	105
Fig. 82:	Distribution of Land Cover Class Index (November 2000) within the Geomorphological Units and the Watershed	108
Fig. 83:	Boxplot of Land Cover Classes within the Geomorphological Units.....	108
Fig. 84:	Land Cover Class Index of November 2000.....	110
Fig. 85:	LCCI versus NDVI for January	111
Fig. 86:	‘White Layer’ investigated during Field Trips.....	127
Fig. 87:	Decision Tree of the Model DESER	131
Fig. 88:	Velocity of Surface Runoff	134
Fig. 89:	Geo-factors relevant for Soil Erosion.....	137
Fig. 90:	Erosion and Soil Erosion Risk in the <i>Bilate</i> Watershed.....	142
Fig. 91:	Distribution of Erosion and Soil Erosion Risk.....	143
Fig. 92:	Potential Erosion and Soil Erosion Risk – Detailed Map of the Central Part of the <i>Rift Valley</i> unit	144
Fig. 93:	Actual Erosion and Soil Erosion Risk – Detailed Map of the Central Part of the <i>Rift Valley</i>	145
Fig. 94:	Distribution of Potential Erosion and Soil Erosion Risk (cells are influenced by neighbourhood five cells).....	146
Fig. 95:	Potential Erosion and Soil Erosion Risk Classes (Cell values are flattened by values of neighbourhood five cells)	146
Fig. 96:	Variability of the K-Factor due to Content of Organic Carbon and Grain Size Distribution.....	149
Fig. 97:	Soil Loss versus Erosion and Soil Erosion.....	152
Fig. 98:	Damages of the Study Site ‘ <i>Ana</i> ’ superimposed on the Risk Map	153

Fig. 99: Damages of the Study Site ‘*Sedebo*’ superimposed on the Risk Map 154

Fig. 100: Erosion and Soil Erosion Risk Classes versus Number of Gullies 154

Fig. 101: Actual Erosion and Soil Erosion Risk before (a) and after doubled population (b) 155

Fig. 102: Vegetation Cover in the Central Part of the *Rift Valley* before (a) and after doubled population (b) 156

Fig. 103: Vegetation Cover in the Central Part of the Rift Valley before (a) and after Regional Planning Measures (b) 156

Fig. 104: Increasing actual Erosion and Soil Erosion Risk without a) and with Regional Planning b) 157

Fig. 105: Damage Map of the Study Site ‘*Ana*’ 224

Fig. 106: Damage Map of the Study Area ‘*Doyancho*’ 225

Fig. 107: Damage Map of the Study Area ‘*Hage*’ 226

Fig. 108: Damage Map of the Study Area ‘*Sedebo*’ 227

Fig. 109: Damage Map of the Study Site ‘*Agega*’ 228

Fig. 110: Damage Map of the Study Site ‘*Ofi*’ 229

Tables:

Table 1:	Empirical Models	7
Table 2:	Physically Based Models	8
Table 3:	Conceptual Models.....	8
Table 4:	Erosion and Soil Erosion Models.....	9
Table 5:	Data Availability in the <i>Bilate</i> Watershed.....	33
Table 6:	Utilised Satellite Images.....	36
Table 7:	Analysis of Variance of Morphometry across Geomorphological Units.....	56
Table 8:	Allocation of Study Sites – Geomorphological Units.....	58
Table 9:	Remarkable annual precipitation data.....	77
Table 10:	Meteorological Stations.....	78
Table 11:	Monthly Average Precipitation versus Altitude.....	81
Table 12:	Descriptive Statistic of Hourly Precipitation for Three Selected Days in Dry and Rainy Season (Station <i>Hossaina</i>).....	82
Table 13:	River Gauging Stations of the Watershed.....	85
Table 14:	Gaps in Daily Discharge Data of Gauging Station <i>Dimtu</i> (1986).....	86
Table 15:	Descriptive Statistic of Average (1972-2000) Monthly Discharge at <i>Alaba Kulito</i> gauging station [mio m ³].....	87
Table 16:	Descriptive Statistics of average rainfall volumes associated with <i>Tena Bilate (Dimtu)</i> Gauging Station [mio m ³].....	89
Table 17:	Vertical profiles: Location, Relief Properties and association to FAO Soil Unit.....	99
Table 18:	Mineralogical Composition of Profiles in the <i>Rift Valley</i> (VP 032) and in the <i>Western Ethiopian Highlands</i> (VP 007).....	106
Table 19:	Land Cover Class Index (LCCI)	106
Table 20:	Variance Analysis of Land Cover Classes	108
Table 21:	Intra-annual vegetation cycle	109
Table 22:	FAO texture and correlating classes after HENNINGS (1994).....	138
Table 23:	FAO stone coverage and correlating classes after HENNINGS (1994).....	138
Table 24:	Reclassification of flow accumulation	139
Table 25:	Reclassification of the ‘BaseEroRisk’.....	140
Table 26:	Statistics of the Risk Values for the Geomorphological Units.....	143
